

## COMPREHENSIVE SERVICES

We offer competitive repair and calibration services, as well as easily accessible documentation and free downloadable resources.

## SELL YOUR SURPLUS

We buy new, used, decommissioned, and surplus parts from every NI series. We work out the best solution to suit your individual needs.

 Sell For Cash    Get Credit    Receive a Trade-In Deal

## OBSOLETE NI HARDWARE IN STOCK & READY TO SHIP

We stock **New**, **New Surplus**, **Refurbished**, and **Reconditioned** NI Hardware.



*Bridging the gap between the manufacturer and your legacy test system.*

 1-800-915-6216

 [www.apexwaves.com](http://www.apexwaves.com)

 [sales@apexwaves.com](mailto:sales@apexwaves.com)

*All trademarks, brands, and brand names are the property of their respective owners.*

**Request a Quote**

 **CLICK HERE**

**NI-9252**

## CALIBRATION PROCEDURE

# NI 9252

8 AI,  $\pm 10$  V, 24 bit, 50 kS/s/ch Simultaneous

This document contains the verification and adjustment procedures for NI 9252. For more information about calibration solutions, visit [ni.com/calibration](http://ni.com/calibration).

## Contents

---

Software.....	1
Documentation.....	1
Test Equipment.....	2
Test Conditions.....	3
Initial Setup.....	3
Verification.....	3
Accuracy Verification.....	3
Adjustment.....	5
Accuracy Adjustment.....	5
EEPROM Update.....	6
Reverification.....	6
Accuracy under Calibration Conditions.....	6
Worldwide Support and Services.....	7

## Software

---

Calibrating the NI 9252 requires the installation of NI-DAQmx 19.1 or later on the calibration system.

You can download NI-DAQmx from [ni.com/downloads](http://ni.com/downloads). NI-DAQmx supports LabVIEW, LabWindows™/CVI™, ANSI C, and .NET. When you install NI-DAQmx, you only need to install support for the application software that you intend to use.

## Documentation

---

Consult the following documents for information about the NI 9252, NI-DAQmx, and your application software. All documents are available on [ni.com](http://ni.com) and help files install with the software.



*NI cDAQ-9174/9178 USB Chassis Quick Start*

NI-DAQmx installation and hardware setup



*NI 9252 Getting Started Guide*

NI 9252 connection information



*NI 9252 Datasheet*

NI 9252 circuitry and specifications



*NI-DAQmx Readme*

Operating system and application software support in NI-DAQmx



*LabVIEW Help*

LabVIEW programming concepts and reference information about NI-DAQmx VIs and functions



*NI-DAQmx C Reference Help*

Reference information for NI-DAQmx C functions and NI-DAQmx C properties



*NI-DAQmx .NET Help Support for Visual Studio*

Reference information for NI-DAQmx .NET methods and NI-DAQmx .NET properties, key concepts, and a C enum to .NET enum mapping table

## Test Equipment

The following table lists the equipment recommended for the performance verification and adjustment procedures. If the recommended equipment is not available, select a substitute using the requirements listed.

**Table 1.** Recommended Equipment

Equipment	Recommended Model	Requirements
Calibrator	Fluke 5502A	Use a high-precision DC voltage source with a gain uncertainty of <57 ppm and an offset uncertainty of <0.6 mV.
Chassis	NI cDAQ-9178	—
DSUB Connection Accessory <sup>1</sup>	NI 9923	—

<sup>1</sup> For NI 9252 with DSUB variant

# Test Conditions

---

The following setup and environmental conditions are required to ensure the device meets published specifications.

- Keep connections to the device as short as possible. Long cables and wires act as antennas, picking up extra noise that can affect measurements.
- Verify that all connections to the device are secure.
- Use shielded copper wire for all cable connections to the device. Use twisted-pairs wire to eliminate noise and thermal offsets.
- Maintain an ambient temperature of  $23\text{ }^{\circ}\text{C} \pm 5\text{ }^{\circ}\text{C}$ .
- Keep relative humidity below 80%.
- Allow a warm-up time of at least 10 minutes to ensure that the device measurement circuitry is at a stable operating temperature.

## Initial Setup

---

Complete the following steps to set up the NI 9252.

1. Install NI-DAQmx.
2. Make sure that the NI cDAQ-9178 power source is not connected to the chassis.
3. Connect the NI cDAQ-9178 chassis to the system safety ground.
  - a) Attach a ring lug to a 14 AWG (1.6 mm) wire.
  - b) Connect the ring lug to the ground terminal on the side of the NI cDAQ-9178 using the ground screw.
  - c) Attach the other end of the wire to the system safety ground.
4. Install the module in slot 8 of the NI cDAQ-9178 chassis. Leave slots 1 through 7 of the NI cDAQ-9178 chassis empty.
5. Connect the NI cDAQ-9178 chassis to your host computer.
6. Connect the power source to the NI cDAQ-9178 chassis.
7. Launch Measurement & Automation Explorer (MAX).
8. Right-click the device name and select **Self-Test** to ensure that the module is working properly.

## Verification

---


The following performance verification procedure describes the sequence of operation and provides test points required to verify the NI 9252. The verification procedure assumes that adequate traceable uncertainties are available for the calibration references.

### Accuracy Verification

Complete the following procedure to determine the As-Found status of the NI 9252.

1. Set the calibrator to Standby mode (STBY).
2. Connect the NI 9252 to the calibrator as shown in the following figure.

**Figure 1. Analog Input Verification Connections**

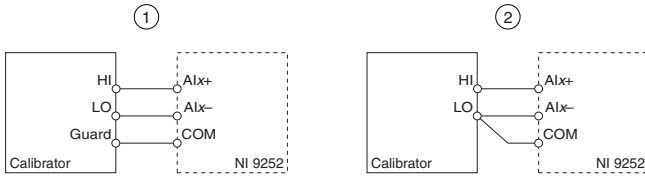

**Note** If the calibrator outputs are truly floating, connect the negative output to a quiet earth ground as well as COM to give the entire system a ground reference.

3. Set the calibrator voltage to a Test Point value indicated in the *NI 9252 Verification Test Limits* table.
4. Set the calibrator to Operate mode (OPR).
5. Acquire and average samples.
  - a) Create and configure an AI voltage channel according to the following *NI 9252 AI Voltage Task* table.

**Table 2. NI 9252 AI Voltage Task**

Physical Channels	Range	Terminal Configuration
cDAQMod8/AI0:7	±10.5 V	Differential

- b) Configure the AI voltage channel timing according to the following *NI 9252 Task Timing* table.

**Table 3. NI 9252 Task Timing**

Samples Per Channel	Acquisition Mode	Rate (kS/s)
1000	Finite Samples	50

- c) Set the filter frequency to 3125 Hz using the Channel Property (**Analog Input»General Properties»Digital Filter»Notch»Center Frequency**).
  - d) Start the task.
  - e) Read the samples from the NI 9252.
  - f) Average the samples.
  - g) Clear the task.
6. Compare the averaged samples to the limits in the *NI 9252 Verification Test Limits* table to verify the input accuracy. If the values are within these limits, the device passes the test.
  7. Set the calibrator to Standby mode (STBY).
  8. Repeat steps 3 through 7 for each test point in the *NI 9252 Verification Test Limits* table.

- Disconnect the calibrator from the device.

**Table 4.** NI 9252 Verification Test Limits

Test Points	Device Under Test Settings/Configuration					Standard Settings/ Configuration
	Data Rate (kS/s)	Samples Per Channel	Filter Frequency (Hz)	Lower Limit (VDC)	Upper Limit (VDC)	Output Voltage (V)
1	50	1000	3125	-10.0167	-9.9833	-10.0000
2	50	1000	3125	-0.0026	0.0026	0.0000
3	50	1000	3125	9.9833	10.0167	10.0000



**Note** The test limits listed in the *NI 9252 Verification Test Limits* table are derived using values from the *NI 9252 Accuracy Under Calibration Conditions* table.

## Adjustment

The following performance adjustment procedure describes the sequence of operation required to adjust the NI 9252.

### Accuracy Adjustment

Complete the following procedure to adjust the accuracy performance of the NI 9252.

- Set the calibrator to Standby mode (STBY).
- Connect the NI 9252 to the calibrator as shown in the *Accuracy Verification* section.
- Adjust the NI 9252.
  - Initialize a calibration session on the NI 9252. The default password is NI.
  - Input the external temperature in degrees Celsius.
  - Call the NI 9252 get C Series adjustment points function to obtain an array of recommended calibration voltages for the NI 9252.
  - Set the calibrator to a reference value determined by the array of recommended calibration voltages.
  - Set the calibrator to Operate mode (OPR).
  - Call and configure the NI 9252 adjustment function according to *NI 9252 Adjustment Configuration* table.

**Table 5. NI 9252 Adjustment Configuration**

Physical Channel	Reference Value
cDAQ1Mod8/AI0:7	The actual value of the voltage output of the calibrator



**Note** The module acquisition is started each time the adjust function is called. There is a delay of approximately 550  $\mu$ s from the acquisition start until module data becomes available.

- g) Set the calibrator to Standby mode (STBY).
  - h) Repeat steps d through g for each point in the array.
  - i) Close the calibration session.
  - j) Clear the task.
4. Disconnect the NI 9252 from the calibrator.

## EEPROM Update

---

When an adjustment procedure is completed, the NI 9252 internal calibration memory (EEPROM) is immediately updated.

If you do not want to perform an adjustment, you can update the calibration date and onboard calibration temperature without making any adjustments by initializing an external calibration, setting the C Series calibration temperature, and closing the external calibration.

## Reverification

---

Repeat the *Verification* section to determine the As-Left status of the device.



**Note** If any test fails Reverification after performing an adjustment, verify that you have met the Test Conditions before returning your device to NI. Refer to the *Worldwide Support and Services* section for assistance in returning the device to NI.

## Accuracy under Calibration Conditions

---

The values in the following table are based on calibrated scaling coefficients, which are stored in the onboard EEPROM.

The following accuracy table is valid for calibration under the following conditions:

- Ambient temperature 23  $^{\circ}$ C  $\pm$  5  $^{\circ}$ C
- NI 9252 installed in slot 8 of an NI cDAQ-9178 chassis
- Slots 1 through 7 of the NI cDAQ-9178 chassis are empty

**Table 6.** NI 9252 Accuracy under Calibration Conditions

Device	Percent of Reading (Gain Error)	Percentage of Range (Offset Error) <sup>2</sup>
NI 9252	0.14%	0.025%



**Note** For operational specifications, refer to the most recent *NI 9252 Datasheet* online at [ni.com/manuals](http://ni.com/manuals).

## Worldwide Support and Services

---

The NI website is your complete resource for technical support. At [ni.com/support](http://ni.com/support), you have access to everything from troubleshooting and application development self-help resources to email and phone assistance from NI Application Engineers.

Visit [ni.com/services](http://ni.com/services) for information about the services NI offers.

Visit [ni.com/register](http://ni.com/register) to register your NI product. Product registration facilitates technical support and ensures that you receive important information updates from NI.

NI corporate headquarters is located at 11500 North Mopac Expressway, Austin, Texas, 78759-3504. NI also has offices located around the world. For support in the United States, create your service request at [ni.com/support](http://ni.com/support) or dial 1 866 ASK MYNI (275 6964). For support outside the United States, visit the *Worldwide Offices* section of [ni.com/niglobal](http://ni.com/niglobal) to access the branch office websites, which provide up-to-date contact information.

---

<sup>2</sup> Range equals 10.5 V.



Information is subject to change without notice. Refer to the *NI Trademarks and Logo Guidelines* at [ni.com/trademarks](http://ni.com/trademarks) for information on NI trademarks. Other product and company names mentioned herein are trademarks or trade names of their respective companies. For patents covering NI products/technology, refer to the appropriate location: **Help»Patents** in your software, the `patents.txt` file on your media, or the *National Instruments Patent Notice* at [ni.com/patents](http://ni.com/patents). You can find information about end-user license agreements (EULAs) and third-party legal notices in the `readme` file for your NI product. Refer to the *Export Compliance Information* at [ni.com/legal/export-compliance](http://ni.com/legal/export-compliance) for the NI global trade compliance policy and how to obtain relevant HTS codes, ECCNs, and other import/export data. NI MAKES NO EXPRESS OR IMPLIED WARRANTIES AS TO THE ACCURACY OF THE INFORMATION CONTAINED HEREIN AND SHALL NOT BE LIABLE FOR ANY ERRORS. U.S. Government Customers: The data contained in this manual was developed at private expense and is subject to the applicable limited rights and restricted data rights as set forth in FAR 52.227-14, DFAR 252.227-7014, and DFAR 252.227-7015.

© 2019 National Instruments. All rights reserved.

378062A-01 August 22, 2019